

Operating Manual
WA-1150 and WA-1650 Wavemeter®
optical wavelength meter

09042-M-00 (Rev. C)



© 2002 EXFO Burleigh Products Group Inc.
All Rights Reserved.

Wavemeter is a registered trademark of Burleigh Instruments, Inc., an EXFO company.

Table of Contents

1. Introduction.....	1-1
Overview	1-1
Safety Considerations.....	1-2
Unpacking & Inspection	1-2
Setup	1-3
Fiber End Cleaning	1-3
Cleaning a Fiber-Optic Connector	1-4
Cleaning a Universal Connector	1-4
Routine Maintenance.....	1-5
2. Front Panel Controls and Screens.....	2-1
Front Panel Controls.....	2-1
Using the Front Panel Controls	2-2
Change Screens.....	2-2
Change Parameter Values	2-2
Save Parameter Values.....	2-3
Restore Saved Parameter Values	2-3
Display Screens.....	2-3
Setup Screens	2-5
3. Remote Communications	3-1
Overview	3-1
SCPI Communications Scheme	3-1
SCPI Command Detail	3-5
Common Commands	3-5
Measurement Instructions	3-8
CALCulate Subsystem	3-10
DISPlay Subsystem	3-13
SENSe Subsystem	3-15
STATus Subsystem.....	3-17
SYSTem Subsystem	3-19
TRIGger Subsystem	3-21
UNIT Subsystem	3-21
4. Theory of Operation & Calibration.....	4-1
Operating Principles	4-1
Wavelength Accuracy.....	4-1
Power Accuracy.....	4-2
Calibration.....	4-2
Appendix A. Specifications & Labeling.....	A-1
Dimensional Drawing.....	A-2
Rack Mounting Option	A-3
Appendix B. Warranty & Service.....	B-1
Warranty	B-1
Service.....	B-1

Appendix C. Error & Status Messages.....	C-1
Error Messages.....	C-1
Status Messages.....	C-2
Appendix D. Rear Panel Controls.....	D-1
Rear Panel	D-1
GPIB Interface.....	D-1
GPIB System Controller Settings	D-2
RS-232 Interface	D-3
Signal Monitor Connector.....	D-4
Changing Fuses	D-6

Index

Declaration of Conformity

Assumptions

This operating manual provides information for individuals who use the EXFO WA-1150 and WA-1650 Wavemeter optical wavelength meters.

Unless specifically stated, the information in this manual applies to both the WA-1150 and WA-1650 models.

This manual assumes familiarity with communication software and hardware interfaces with an IBM, or compatible, personal computer.

1. Introduction

This section provides general information on the WA-1150 and WA-1650 and information on unpacking and setting them up.

Overview

EXFO's WA-1150 and WA-1650 Wavemeter[®] optical wavelength meters are instruments designed for simple, automatic and accurate wavelength measurement of continuous wave (CW) and modulated laser sources. They analyze interference fringes produced by the input laser radiation in a scanning Michelson interferometer with a built-in reference laser.

Both the WA-1150 and WA-1650 have microprocessor-based electronics that allow accurate counting and analysis of interference fringes. The microprocessor computation automatically corrects for the refractive index of air, using data from built-in temperature and pressure sensors and converts the resulting measurement to units of nm or GHz. The microprocessor also makes it possible for the WA-1150 and WA-1650 to calculate and display the deviation between the measured wavelength and starting point, or compute the average of up to 128 measurements. Refer to Section 4, **Theory of Operation & Calibration**, for additional information on the theory of operation.

Introduce laser light into the WA-1150 or WA-1650 by attaching your fiber-optic cable to the fiber-optic connector on the front of the unit. The standard connector is the EXFO universal FC/UPC connector. FC/APC, SC/UPC, SC/APC and ST/UPC connectors are available as an option at the time of order.

The instrument's front panel has controls to review data and review and change parameter values. Refer to Section 2, **Front Panel Controls and Screens**, for information on the controls and display and setup screens.

The WA-1150/WA-1650 have a built-in bi-directional RS-232 interface and a GPIB interface for transmitting data and remotely controlling the instrument. Refer to Section 3, **Remote Communications**, for information on these interfaces and the SCPI communication scheme.

The Monitor port on the back of the system provides access to the interferometer fringe signals and timing signals that govern the wavelength measurement. Refer to Appendix D, **Rear Panel Controls**, for further information.

Safety Considerations

This product has been designed, manufactured and tested in accordance with EC Standard EN61010-1, Safety Requirements for Electronic Measuring Apparatus and has been supplied in a safe condition. Make sure that you follow the recommendations in this section to ensure safe operation of your instrument and to maintain the product in a safe condition.

Laser Classification: This product is classified FDA Laser Class I (IEC Laser Class 1) laser.

- | | |
|----------------|--|
| WARNING | THIS EQUIPMENT MUST BE USED AS SPECIFIED OR THE PROTECTION PROVIDED BY THE EQUIPMENT MAY BE COMPROMISED. YOU MUST USE THIS PRODUCT IN A NORMAL MODE AND SHOULD NOT DEVIATE FROM THE WRITTEN INSTRUCTIONS PROVIDED. |
| WARNING | THERE ARE NO OPERATOR-SERVICEABLE PARTS INSIDE. REFER SERVICING TO QUALIFIED PERSONNEL. TO PREVENT ELECTRICAL SHOCK, DO NOT OPEN OR REMOVE COVERS. |
| WARNING | TO PREVENT ELECTRICAL SHOCK, TURN OFF THE POWER TO THE SYSTEM BEFORE CLEANING. USE A DRY OR SLIGHTLY DAMPENED (WITH WATER) CLOTH TO CLEAN THE EXTERNAL PARTS. DO NOT ATTEMPT TO CLEAN ANYTHING INSIDE THE INSTRUMENT. |
| WARNING | THIS IS A SAFETY CLASS 1 PRODUCT. PLUG THE MAIN POWER CORD INTO A SOCKET OUTLET PROVIDED WITH A PROTECTIVE EARTH CONTACT. ALWAYS USE A THREE-PRONG AC POWER CORD WITH THIS EQUIPMENT. FAILURE TO ENSURE ADEQUATE GROUNDING MAY CAUSE INSTRUMENT DAMAGE. |

Unpacking & Inspection

The WA-1150 and WA-1650 are packed in a carton designed to give maximum protection during shipment. If the outside of the shipping carton is damaged, notify your shipping department immediately. Your shipping department may want to notify the carrier.

If the external shipping carton is not damaged, carefully remove and identify all of the components listed below. Contact EXFO or your local representative if any of the components are missing. We recommend you save the shipping carton for future storage or transportation.

The WA-1150/WA-1650 include the following components:

- Wavemeter unit
- Power cord
- Operating manual
- Optional rack mounts

Setup

Setting up the WA-1150/WA-1650 is a very simple operation as described in the procedure below.

For benchtop operation, place the instrument on a firm horizontal surface.

Attach the AC line cord. The WA-1150/WA-1650 uses a universal power supply that works with any line voltage 90-260 VAC, 50/60 Hz.

Turn on the power switch. The system's self-test takes approximately 30 seconds. For WA-1650 models, the display indicates Laser Warm-up and the elapsed time since the unit was turned on. This message is displayed until the reference laser inside the WA-1650 is stabilized. Typical laser warm-up time is approximately 6 minutes (WA-1650 only).

Ensure all fiber-optic connectors are clean and dry (see below). Then connect your fiber-optic cable to the fiber-optic connector on the instrument front panel. Make sure the fiber end does not rub against any surface and do not overtighten.

CAUTION The WA-1150/WA-1650 are designed to operate within the specified environmental specifications. This requires proper ventilation. Do not block the rear fan. Do not place the back of the instrument in an enclosed area that limits free airflow.

CAUTION Use care in handling fiber-optic connectors. Always clean the fiber end prior to insertion into the connector for optimum performance and to avoid power measurement errors.

Fiber End Cleaning

To make good optical measurements, it is extremely important to clean the fiber-optic connector before each connection. Dirt on the connector can degrade the reliability of the measurement and cause permanent damage to the connector resulting in an expensive repair.

Modern fiber-optic connectors rely on a glass-to-glass contact to reduce Fresnel reflections at the connector interface. A dirty or damaged connector on the cable can damage the input connector on the instrument front panel. Always use a good quality cable connector. If there is any question of the surface quality on the tip of the cable connector, inspect it under a microscope for scratches or debris.

Some general recommendations:

- Never use a metal or other hard object for cleaning that would scrape the connector.
- Do not apply index-matching gel or oils.
- Always keep connectors covered for protection when not in use.

Cleaning a Fiber-Optic Connector

To clean the end of the connector on the fiber-optic cable,

1. Gently wipe the tip with a lint-free swab or lens paper dipped in isopropyl alcohol.
2. Dry it by wiping gently with a clean dry lint-free lens paper.
3. As soon as the connector is dry, insert it in the instrument panel or cover it for later use.

Cleaning a Universal Connector


NOTE Refer to Figure 1-1 below.

To clean the end of the universal connector,

1. Unscrew the fiber from the instrument and put a protective cap on it.
2. Close the universal protective fiber cap.
3. Gently push in the universal connector and rotate it counter-clockwise $\frac{1}{4}$ turn.
4. Pull out the fiber-optic adapter.
5. Gently wipe the tip with a lint-free swab or lens paper dipped in isopropyl alcohol.
6. Dry it by wiping gently with a clean dry lint-free lens paper.
7. As soon as the connector is dry, insert it in the instrument front panel or cover it for later use.

NOTE The fiber-optic adapter is keyed. Insert the adapter in the same position that you removed it.

8. Rotate the universal connector $\frac{1}{4}$ turn to lock it in.

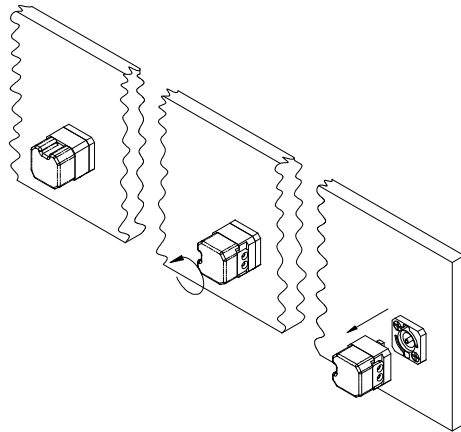Figure 1-1. Universal connector removal sequence

Routine Maintenance

The fan on the rear panel of the WA-1150/1650 provides important ventilation to components inside the chassis. A filter covers the fan opening to keep out dust. This filter should be cleaned periodically, especially in a high dust environment or if it becomes noticeably dirty. You must keep the filter clean in order to ensure proper operation of the instrument.

To clean the dust filter,

1. Pry off the plastic grill covering the filter with a small screwdriver.
2. Remove the foam filter.
3. Use a small brush, plus soap and water (if necessary), to clean the filter.
4. When the filter is dry, reposition it in the fan housing and snap the grill back in place.

2. Front Panel Controls and Screens

This section provides information on the WA-1150/WA-1650 front panel controls, describes the display and setup screens and provides instructions on changing screen displays and parameter values.

Front Panel Controls

The front panel is shown in Figure 2.1. The controls are described in Table 2-1.

The display consists of an 8½ digit numerical readout and buttons for selecting parameters that affect how the data is collected and how the information is displayed. There are several different screens, each with different information as shown and described later in this section.

Figure 2-1. Front Panel

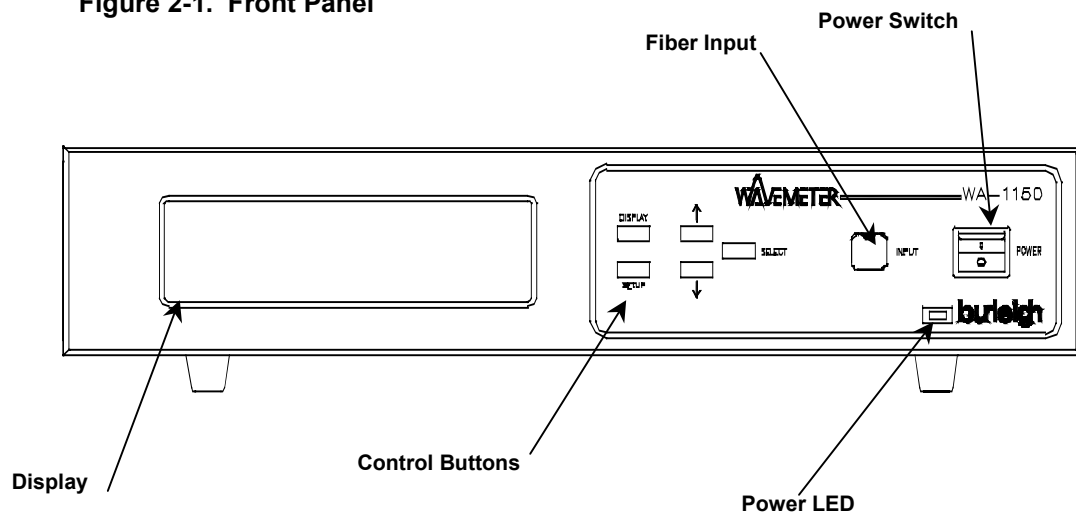


Table 2-1 Front Panel Controls

Control	Description
Power	Switch turns the instrument on and off.
LED	Indicator shows the power status. When lit, the unit is turned on; when not lit, the unit is off.
Display	Button cycles through the display screens: Main, Wavelength and Power. Display screens contain parameters you can review and select as well as calculated or measured data for review only. Refer to 'Display Information' later in this section for additional information.
Setup	Button cycles through the setup screens: Measurement, Communications, System and Status. Setup screens contain a list of parameters for review and change. Refer to 'Setup Information' later in this section for additional information.
Select	Button "highlights" or selects parameters on the displayed screen.
↑ and ↓	Buttons change the value of the selected parameter.

Using the Front Panel Controls

Use the four display area controls to review information and make changes to the available parameters. The headings below provide information on how to perform various procedures using these front panel controls.

Change Screens

To change which display screen is shown, press **Display**. The instrument cycles between the display screens. To change which setup screen is shown, press **Setup**. The instrument cycles between the setup screens.

Change Parameter Values

Each display and setup screen contains parameters whose values you can change. (Display screens also contain calculated or measured data.) Some parameters are located below the line on the bottom of the display screens and other parameters are located above the line, such as the wavelength and power units. Refer to Figures 2-2 through 2-4 for graphic illustrations of the parameters on each display screen.

To change a parameter value or status, press **Select** to highlight the parameter field, then press ↑ or ↓. The parameter's value or status changes.

NOTE If the message "Remote Lockout" is displayed on the screen when you attempt to change a parameter value, remote communications is enabled (on). When enabled, you can use

the front panel controls to review all parameter values, but you cannot change any parameters except the status of the remote feature to off.

Save Parameter Values

You may want to save parameter values that are appropriate for your application, so that each time you power up the instrument, this information is selected automatically. Or, if you have several instruments, you may want to set them all up the same way.

To save parameter values, display the Configuration screen, press **Select** to highlight the Save All field, then press either press $\uparrow$ or $\downarrow$. The current parameter values are saved.

Restore Saved Parameter Values

You may want to restore saved parameter values, for example, if you change the value for a parameter or several parameters to observe their effect, but then decide you want to use the initial values.

To restore saved values, display the Setup Measurements screen, press **Select** to highlight the Restore All field. The saved values are restored.

Display Screens

The display screens provide measurement information as summarized below. Figures 2-2 through 2-4 show each display screen and Table 2-2 describes each item on these screens. You access the three display screens by pressing **Display** on the instrument front panel and toggling the key to move through the choices.

Main. Initially displays a start-up screen for approximately 30 seconds after you first power on the unit. After a self-test and reference laser warm-up (WA-1650 only), the screen is replaced with summary information on the current wavelength and power and pertinent parameter values. For the WA-1650 only, if the warm-up time is greater than 59 minutes, an exception occurs, which causes the wavelength to not be displayed, yet all system functions are active. Warm-up time at room temperature (20°C) typically is less than seven minutes.

Wavelength. Displays wavelength information and two methods of calculating delta (Δ) for a comparative analysis. This screen shows the following numeric values: Current wavelength, Start, Δ (Current – Start), Maximum, Minimum, Δ (Maximum – Minimum) as well as the elapsed time and pertinent parameter values.

Power. Displays power information and two methods of calculating delta (Δ) for a comparative analysis. This screen shows the following numeric values: Current power,

Start, Δ (Current – Start), Maximum, Minimum, Δ (Maximum – Minimum) as well as the elapsed time and pertinent parameter values.

Figure 2-2. Main Screen

Wavelength		Power		
1552.5218 nm		-21.54 dBm		
Wavelength Range				
	Vacuum	Avg: 8	Poffs: Off	00:03:12

Figure 2-3. Wavelength Screen

1552.5218 nm		Start: 1552.5212	Δ : 0.0006
Max: 1552.5200		Min: 1552.5235	Δ : 0.0035
Wavelength Range			
	Vacuum	Avg: 8	Reset
		00:03:12	

Figure 2-4. Power Screen

-11.54 dBm		Start: -11.52	Δ : -0.02
Max: -11.60		Min: -11.50	Δ : -0.10
Wavelength Range			
	Poffs, Off	Avg: 8	Reset
		00:03:12	

Table 2-2. Display Screen Information

Parameter	Description
Avg	Displays the number of previous measurements used to calculate the running average. Calculation of the average wavelength and power uses the same average value. On the Main and Wavelength screens, you can toggle the average between Off and the numeric value set using the Measurement setup screen. Off indicates averaging is not used. Numeric value (2, 4, 8, 16, 32, 64, or 128). Change the numeric value on the Measurement setup screen.
Vacuum/Std. Air	Identifies the medium in which the measurement occurs as standard air (15°C, 760 mm Hg and 0% relative humidity) or vacuum. You can change the medium to vacuum on the Main and Wavelength screens.
Poffs	Displays the power offset value applied to subsequent power measurements. These values enable you to obtain accurate power readings when you place an attenuator external to the instrument. If you enter a power offset value equal to the external attenuator, the instrument automatically displays the correct power. This is useful if the signal input power exceeds the maximum allowed input of 10 mW (10 dBm). Off indicates a power offset is not used. Numeric value (1, 2, ..., 20 in dB units). You cannot change the type of units. Change the numeric value on the Measurement setup screen.
Power Units	The current laser power displayed in the selected units. You can change the type of units on the Main or Power display screen. The options are dBm and mW or (μ W). If mW or μ W are selected, the Power Autorange feature automatically sets units to mW or μ W depending on input power.
Reset	Restarts calculations of Current - Start and Max - Min. When actuated, it zeros elapsed time, then displays the start and current values.
Error Message	Indicates an error message, if any. See Appendix C for messages and corrective action.
Wavelength Units	The current wavelength displayed in the selected units. You can change the units on the Main or Wavelength display screen. The units are nm and GHz. If an error has occurred, this area displays a status message. See Appendix C for messages and corrective action.
	Presence indicates that an exception has occurred. Check the status screen or read the status byte. See Appendix C for messages and corrective action.

Setup Screens

The setup screens provide information that affects the display of measured values and calculation of values. Each screen is summarized below and described in more detail in the tables that follow. Access the setup screens by pressing **Setup** on the instrument front panel and toggling the key to move through the choices.

- **Configuration.** Contains parameters that affect how the instrument makes specific calculations and how it determines the information on the instrument display, for example, save and recall the parameter selections, change the brightness of the instrument display and reset the null value for power measurement. See Table 2-3 for details.
- **Communications.** Use to change remote communication parameters. See Table 2-4 for details.
- **Information.** Displays the instrument serial number and software version information, reference laser information, pressure and internal temperature for review. The WA-1650 reference laser information includes the peak power, percent of peak power and the minutes to warm up, and the WA-1150 displays just the peak power. See Table 2-5 for details.
- **Status.** Displays the status codes that indicate the latest exceptions that have occurred. See Appendix C for messages and corrective action.

Table 2-3. Configuration

Parameter	Description/Options
Resolution	Identifies the wavelength resolution value. .0001, .001, .01, 0.1, 1.0, 10.0. Selectable wavelength resolution values. Displayed values are rounded off to the selected number of decimal places. The .0001 resolution is not available for the WA-1150.
Average	Identifies the number of previous wavelength and power values to use to calculate the running average. The display is updated with each new measurement. Off indicates values are not averaged. 2, 4, 8, ..., 128 (powers of 2). Selections for average values.
Power Offset	Displays the power offset (Poffs) value applied to subsequent power measurements. These values enable you to obtain accurate power readings when you place an attenuator external to the instrument. If you enter a power offset value equal to the amount of external attenuation, the instrument automatically displays the correct power. This is useful if the signal input power exceeds the maximum allowed input of 10 mW (10 dBm). Change the offset value on the Main and Measurement setup screens. Off indicates a power offset is not used. 1, 2, ..., 20 in dBm units. You cannot change the units for the offset.
Power Null	Resets the null value used in the power calculation. Use only when no light is entering the instrument and the fiber connector cap is on.
Frequency Range	Allows the user to select range of operation. For the WA-1150, either 700 to 1266 nm or 1266 to 1650 nm. The WA-1650 has four operational wavelength ranges: 700 to 1266 nm, 1266 to 1650 nm, 1266 to 1475 nm and 1450 to 1650 nm. Operating the WA-1650 in the 1266 to 1650 nm range reduces the measurement update time to 2 seconds. All other ranges operate at a 1-second measurement update rate.
Brightness	Changes the brightness of the display. High: Maximum intensity.

	Low: 62.5% of the maximum intensity.
Save All	Allows you to save the current parameter values.
Restore All	Allows you to restore the saved parameter values.

Table 2-4. Communication

Parameter	Description/Options
Remote (Lockout)	When enabled (on) you can use the front panel controls to review parameter values, but can only change (disable) the "Remote" parameter. Attempting to change other parameters when this feature is enabled will display the message "Remote Lockout". Off permits changing all front panel controls.
RS-232	Enables (on) and disables (off) communications via the RS-232 port.
Baud	Identifies the baud rate for the RS-232 communications. The selections are: 1200, 2400, 4800, 9600 and 19200 baud.
Handshaking	Identifies the type of handshaking used for the RS-232 communications. The selections are Hardware, Xon/Xoff (software) or None.
GPIB	Enables (on) and disables (off) communications via the GPIB port.
Address	Identifies the address used for GPIB output. The selections are 0, 1, 2, ..., 31.

Table 2-5. Information

Parameter	Description/Options
Serial #	The identification number of the instrument.
Internal Temp.	Environmental parameter for the interferometer.
Ref Laser Power	Information on the status of the reference laser.
% of Peak Power	Information on the status of the reference laser.
Version	The current software revision.
Pressure	Environmental parameter for the interferometer.
Warm-Up Time	Information on the status of the reference laser.

The Status screen provides internal status messages for service use only.

3. Remote Communications

This section discusses the use of remote communications to review and control the instrument.

Overview

You can control the instrument remotely using either an RS-232 or a GPIB interface using the SCPI communications scheme. Connections for both interfaces are provided on the back of the instrument as shown later in this section.

You must use the instrument front panel controls to enable remote communications for the specific type of interface. Refer to Table 2-4 in Section 2 of this manual for information.

SCPI Communications Scheme

This topic provides information on the communication scheme that follows the Standard Commands for Programmable Instruments (SCPI) Syntax and Style Guidelines.

Table 3-3 provides a summary of commands by subsystem and the information after the table describes each command in detail.

Note: [...] indicates an optional argument. {...|...|...} indicates a choice from a set of arguments.

Table 3-3. SCPI Command Summary

Group & Command	Description
Common Commands	Defined by IEEE 488.2, these control some functions that are common to all IEEE 488.2 instruments.
*CLS	Clears all event registers and the error queue.
*ESE?	Queries the bits in the standard event status enable register.
*ESE <integer>	Sets the bits in the standard event status enable register.
*ESR?	Queries value standard event status register.
*IDN?	Queries instrument model number, serial number and firmware version.
*OPC?	Queries the operation complete bit of the standard-event status register.

*OPC	Sets operation complete bit of the standard event status register.
*RCL	Restores instrument settings.
*RST	Resets instrument to default settings.
*SAV	Saves instrument settings.
*STB?	Queries the value of status byte.
Measurement Instructions	These commands configure and obtain measurements from the instrument.
:CONFigure?	Queries the measurement subsystem for measurement type.
:CONFigure{:POWer :ENVironment :WAVelength :FREQuency}	Configures the MEASurement subsystem for power, environment, wavelength or frequency.
:FETCh{:POWer :ENVironment :FREQuency :WAVelength}?	Queries power, environment, frequency and wavelength that have already been captured during the last scan.
:MEASure{:POWer :ENVironment :FREQuency :WAVelength}?	Queries power, environment, frequency and wavelength that will be captured during the next scan. Measure is the equivalent of ABORt; INITiate; FETCh.
:READ{:POWer :ENVironment :FREQuency :WAVelength}?	Queries power, environment, frequency and wavelength that will be captured during the next scan. READ is the equivalent of ABORt; INITiate; FETCh. READ is interpreted to mean "initiate a new reading and return the value when the reading is complete."
CALCulate Subsystem	These commands obtain calculated values from the instrument. In general, calculated values are values derived from actual measurements.
:CALCulate:DATA? {POWer FREQuency WAVelength}	Used to set the type of data retrieved from the calculate subsystem.
:CALCulate:DELTA[:STATe]?	Queries if DELTA is to be calculated.
:CALCulate:DELTA[:STATe] {ON OFF}	Selects DELTA as the quantity to be calculated.
:CALCulate:DELTA:METHod?	Queries the method used for DELTA calculation (either Current-Start or Max-Min).
:CALCulate:DELTA:METHod {START MAXMin}	Selects the method used for DELTA calculation (either Current-Start or Max-Min).
:CALCulate:MAXimum[:STATe]?	Queries if MAXimum is to be calculated.
:CALCulate:MAXimum[:STATe] {ON OFF}	Selects MAXimum as the quantity to be calculated. This is the maximum value since the power-on or the last reset.
:CALCulate:MINimum[:STATe]?	Queries if MINimum is to be calculated.
:CALCulate:MINimum[:STATe] {ON OFF}	Selects MINimum as the quantity to be calculated. This is the minimum value since power-on or the last reset.
:CALCulate:RESet	Resets the CALCulate subsystem. This command resets the Elapsed Time counter, sets the Min and Max values to the Current value and sets the Start value to the Current value.

:CALCulate:START[:STATe]?	Queries if START is to be calculated.																								
:CALCulate:START[:STATe] {ON OFF}	Selects START as the quantity to be calculated. This is the first good reading after power-on or last reset.																								
:CALCulate:TIME[:ELAPsed]?	Returns the time since last power on or reset.																								
DISPlay Subsystem	These commands change the state of the instrument's front panel.																								
:DISPlay:DIALog?	Queries the current display screen on the front of the instrument.																								
:DISPlay:DIALog {MAIN WAVelength POWer}	Selects the current display screen on the front of the instrument.																								
:DISPlay:RESolution?	Queries the display resolution.																								
:DISPlay:RESolution {0001 .001 .01 .1 1.0 10.0}	Selects the display resolution. The .0001 resolution is not available on the model WA-1150.																								
:DISPlay:UNITs:POWer?	Queries the power units used for display.																								
:DISPlay:UNITs:POWer {DBM MICRowatts MILLiwatts}	Selects the power units used for display. MICR and MILL are equivalent commands. The instrument will choose one or the other depending on the actual input power level.																								
:DISPlay:UNITs:WAVelength?	Queries the wavelength units used for display.																								
:DISPlay:UNITs:WAVelength {NM GHZ}	Selects the wavelength units used for display.																								
SENSe Subsystem	These commands are used to control factors that affect the way in which the measurements are taken.																								
:SENSe:AVERage?	Queries the amount of averaging that is used in the instrument.																								
:SENSe:AVERage {OFF 2 4 8 ... 128}	Sets the amount of averaging that is used in the instrument.																								
:SENSe:MEDIum?	Queries the type of medium in which the measurements are being made.																								
:SENSe:MEDIum {AIR VACuum}	Selects the type of medium in which the measurements are being made.																								
:SENSe:POWeroffset?	Queries the power offset for the measurements in dBm.																								
:SENSe:POWeroffset {OFF 1 ... 20}	Selects the power offset for the measurements in dBm.																								
:SENSe:REFerence[:PARAmeters]?	Returns information on the reference laser such as power (% of peak, and minutes to warm-up for WA-1650).																								
:SENSe:RANGe {0 – 3}	Sets the spectral range to be measured by the instrument. <table><tr><th colspan="4">Measurement Time</th></tr><tr><th>Range</th><th>Frequency range</th><th>WA-1650</th><th>WA-1150</th></tr><tr><td>0</td><td>700-1266 nm</td><td>1</td><td>1</td></tr><tr><td>1</td><td>1266-1650 nm</td><td>2</td><td>1</td></tr><tr><td>2</td><td>1266-1475 nm</td><td>1</td><td>--</td></tr><tr><td>3</td><td>1450-1650 nm</td><td>1</td><td>--</td></tr></table>	Measurement Time				Range	Frequency range	WA-1650	WA-1150	0	700-1266 nm	1	1	1	1266-1650 nm	2	1	2	1266-1475 nm	1	--	3	1450-1650 nm	1	--
Measurement Time																									
Range	Frequency range	WA-1650	WA-1150																						
0	700-1266 nm	1	1																						
1	1266-1650 nm	2	1																						
2	1266-1475 nm	1	--																						
3	1450-1650 nm	1	--																						
:SENSe:RANGe?	Queries the spectral range being measured by the instrument.																								

STATus Subsystem	These commands are used to retrieve SCPI or instrument status.
:STATus:QUEStionable:CONDition?	This command queries the SCPI Questionable register, which contains bits that indicate that one or more measurement types are of questionable accuracy.
:STATus:QUEStionable:ENABle?	This command queries the Questionable Enable register.
:STATus:QUEStionable:ENABle <integer>	Used to set and clear bits in the SCPI Questionable Enable register.
:STATus:QUEStionable:HARDware:CONDition?	This command queries the hardware to provide information on the status of some of the hardware components, which may contribute to invalid or incorrect measurements.
SYSTem Subsystem	These commands control system-wide parameters.
:SYSTem:ERRor?	Reads error strings from the Error Queue. If the Error Queue has any entries, the Error Queue bit is set in the Status Byte.
:SYSTem:HELp:HEADers?	This query returns a list of all commands/queries supported by the instrument.
:SYSTem:REMote?	This query checks if the front panel is enabled or not. If ON, the front panel is locked out
:SYSTem:REMote {ON OFF}	This command controls whether the front panel is enabled or not. If in Remote mode, the front panel is locked out
:SYSTem:VERSion?	Returns the year and revision of the SCPI standard that the instrument follows.
TRIGger Subsystem	These commands control the triggering of the instrument. Since the instrument is fundamentally not a triggered instrument, these commands have little effect on the instrument's operation.
:TRIGger:ABORt	Aborts a current measurement.
:TRIGger:INITiate[:IMMediate]	Initiates a new reading.
UNIT Subsystem	This command affects the power units used by the SCPI interface.
:UNIT:POWer?	Queries power units (dBm or watts).
:UNIT:POWer {DBM W}	Selects power units to be dBm or watts. This command does not affect the front panel display in any way.

SCPI Command Detail

This section provides detailed information for all SCPI programming commands. The commands are organized by subsystem.

Common Commands

*CLS

Description	*CLS (clear status) command clears the event status register and the error queue.
-------------	---

*ESE?

Description	Queries the bits in the event status enable register.
Query Response	Returns an integer which is the sum of all the bit values for those bits that are set (see Event Status Register Enable table below).

*ESE <integer> mask from 0 to 255

Description	The *ESE (event status enable) command sets the bits in the event status enable register and enables the corresponding events in the event status register. For each bit that is set (equal to 1), it is enabled in the event status register (ESR). <integer> is an integer which is the sum of all of the bit values for those bits that are set.
-------------	---

Event Status Enable Register

Bit	Bit Value	Enables
7	128	Power On (PON)
6	64	Not Used
5	32	Command Error (CME)
4	16	Execution Error (EXE)
3	8	Device Dependent Error (DDE)
2	4	Query Error (QYE)
1	2	Not Used
0	1	Operation Complete (OPC)

*ESR?

Description	The *ESR (event status register) query returns a value which encodes the bits in the event status register. If any bits are set in the ESR, then the ESR
-------------	--

	summary bit will be set in the STB.
Query Response	Returns an integer which is the sum of all the bit values for those bits that are set (see Event Status Register table below).

Event Status Register

Bit	Bit Value	Condition
7	128	Power On (PON)
6	64	Not Used
5	32	Command Error (CME)
4	16	Execution Error (EXE)
3	8	Device Dependent Error (DDE)
2	4	Query Error (QYE)
1	2	Not Used
0	1	Operation Complete (OPC)

***IDN?**

Description	The *IDN (identification number) query returns a string value which contains the instrument type, serial number and firmware version. The third value is the instrument serial number. The last value is the software version and will reflect the actual version number.
Query Response	BURLEIGH WAVEMETERS, WA-1150, 1001, 1.0

***RCL**

Description	The *RCL (recall) command restores instrument settings. It is the same as using the Restore All function through the display.
-------------	---

***RST**

Description	The *RST (reset) command returns the instrument's settings to a known state.
-------------	--

Commands affected by *RST

Command	Setting after an *RST command
:CALCulate:DELTA[STATe]	OFF
:CALCulate:DELTA:METHod	START
:CALCulate:MAXimum[:STATe]	OFF
:CALCulate:MINimum	OFF
:CALCulate:START[:STATe]	OFF
:DISPlay:DIALog	MAIN

:DISPlay:RESolution	AUTO
:DISPlay:UNITs:POWer	DBM
:DISPlay:UNITs:WAVelength	WAVelength
:SENSe:AVERage	OFF
:SENSe:MEDium	VACuum
:SENSe:POWeroffset	OFF
:SYSTem:REMote	OFF
:UNIT:POWer	DBM

***SAV**

Description	The *SAV command saves instrument settings. It is the same as using the Save All function through the display.
-------------	--

***STB?**

Description	The *STB (status byte) query returns the current value of the instrument's status byte.
Query Response	Returns an integer which is the sum of all the bit values for those bits that are set (see the Instrument Status Byte table).

Instrument Status Byte

Bit	Bit Value	Condition
5	32	a bit is set in the questionable register (see STATus subsystem)
3	8	errors are in the error queue (see SYSTem subsystem)
2	4	a bit is set in the event status register

Measurement Instructions

Use the measurement instructions to return a reading to the computer. The four basic measurement instructions are CONFigure, FETCh, READ and MEASure. Functions for these instructions are POWer, ENVironment, WAVelength and FREQuency.

:FETCh will return a reading based on the last complete scan. Using :FETCh, it is possible to get new measurements at the instrument's scan rate of up to 1 per second. However, if :FETCh queries are made faster than the instrument's scan rate, it is possible to get the same reading twice. Old readings are indicated by a bit in the questionable status register.

:MEASure and :READ get a new reading after the next complete scan. :MEASure and :READ guarantee that each reading returned is a new one. If you want to get multiple measurement types from a single scan (i.e. WAVelength, POWer, etc.), use :READ followed by one or more :FETCh queries.

:MEASure and :READ actually are macros that execute multiple SCPI commands. :READ is equivalent to:

```
:ABORt
:INITiate
:FETCh[:<function>]?
```

and :MEASure is equivalent to:

```
:ABORt
:CONFigure <function>
:READ?
```

For the instrument, :MEASure and :READ perform essentially the same function.

:CONFigure?

Description	Queries the current configuration of the measurement subsystem.
Query Response	{POWER ENVIRONMENT WAVELENGTH FREQUENCY}
Example	:CONF?

:CONFigure{ :POWer | :ENVironment | :WAVelength | :FREQuency }

Description	Configures the measurement subsystem for subsequent :FETCh?, :MEASure?, or :READ? queries.
Examples	:CONF:WNUM :CONF:POW

{:MEASure | :READ | :FETCh}{:POWer | :ENVironment | :WAVelength | :FREQuency}?

Description	Queries a reading of the given type from the measurement subsystem.
Query Response	(see below)
Examples	(see below)

Measurement Instruction Functions

:POWer?

Description	Returns a power reading in either watts or dBm as specified by the :UNIT:POWer function.
Query Response	A numerical value in scientific notation. (ex. -1.267E+001)
Examples	:READ:POW? :FETC:POW?

:ENVironment?

Description	Returns the instrument's internal temperature in °C and pressure in mm Hg.
Query Response	Two numerical values with units separated by a comma. (ex. 28.5 C, 740 MMHG)
Examples	:MEAS:ENV? :FETC:ENV?

:WAVelength?

Description	Returns an input laser reading in units of nm.
Query Response	A numerical value in scientific notation (ex. 1.5461108E+003). The number of significant digits will be determined by the current resolution setting. Resolution is set through the front panel or by using the :DISPlay:RESolution command.
Examples	:FETC:WAV? :READ:WAV?

:FREQuency?

Description	Returns an input laser reading in units of GHz.
Query Response	A numerical value in scientific notation (ex. 1.9367357E+005). The number of significant digits will be determined by the current resolution setting. Resolution is set through the front panel or by using the :DISPlay:RESolution command.
Examples	:FETC:FREQ? :MEAS:FREQ?

CALCulate Subsystem

Use the CALCulate subsystem to read and control the instrument's calculated values. The instrument continuously updates minimum and maximum readings as well as deriving deltas such as maximum-minimum and current-start.

To retrieve CALCulate subsystem data, first choose a calculate data type and then perform a calculate query. For example, to read maximum-minimum power, issue the following commands:

:CALC:DELT:STAT ON (Set up to read a delta value.)

:CALC:DELT:METH MAXM (Set up to read maximum-minimum.)

:CALC:DATA? POW (Read the maximum-minimum power.)

The :DELTA, :MAXimum, and :MINimum functions are turned on and off with their respective commands. When one of them is turned on, the others are automatically turned off.

CALCulate Subsystem Functions

:DATA? {POWER | FREQUENCY | WAVELENGTH}

Description	Gets a calculated value of a pre-selected data type. In order for this function to return a result, you must first set up the CALCulate subsystem using the :DELTA, :MAXimum, :MINimum or :START functions.
Query Response	A numerical value in scientific notation (ex. -1.62E+000). The number of significant digits for a FREQUENCY or WAVELENGTH reading will be determined by the current resolution setting. Resolution is set through the front panel or by using the :DISPLAY:RESolution command.
Examples	:CALC:DATA? POW :CALC:DATA? WAV

:DELTA[:STATE]?

Description	Queries the state of the :DELTA function.
Query Response	{0 1} Where 0 indicates OFF and 1 indicates ON.
Examples	:CALC:DELT:STAT? :CALC:DELT?

:DELTA[:STATe] {ON | OFF}

Description	Sets the state of the :DELTA function to either ON or OFF.
*RST value	OFF
Examples	:CALC:DELT OFF :CALC:DELT:STAT ON

:DELTA:METHod?

Description	Queries the state of the :METHod function.
Query Response	{START MAXMIN}
Examples	:CALC:DELT:METH?

:DELTA:METHod {START | MAXMin}

Description	Sets the state of the :METHod function to either START (to get start - current values) or MAXMin (to get maximum - minimum values).
*RST value	START
Examples	:CALC:DELT:METH STAR :CALC:DELT:METH MAXM

:MAXimum[:STATe]?

Description	Queries the state of the :MAXimum function.
Query Response	{0 1} Where 0 indicates OFF and 1 indicates ON.
Examples	:CALC:MAX? :CALC:MAX:STAT?

:MAXimum[:STATe] {ON | OFF}

Description	Sets the state of the :MAXimum function to either ON or OFF.
*RST value	OFF
Examples	:CALC:MAX ON :CALC:MAX:STAT OFF

:MINimum[:STATe]?

Description	Queries the state of the :MINimum function.
Query Response	{0 1} Where 0 indicates OFF and 1 indicates ON.
Examples	:CALC:MIN? :CALC:MIN:STAT?

:MINimum[:STATe] {ON | OFF}

Description	Sets the state of the :MINimum function to either ON or OFF.
*RST value	OFF
Examples	:CALC:MIN ON :CALC:MIN:STAT OFF

:RESet

Description	Resets the minimum, maximum and start values to the current reading. Resets the deltas to zero and sets the elapsed time to 00:00:00. This affects the CALCulate subsystem as well as the instrument's front panel display. It is the same as using the Reset function through the display.
Examples	:CALC:RES

:STARt[:STATe]?

Description	Queries the state of the :STARt function.
Query Response	{0 1} Where 0 indicates OFF and 1 indicates ON.
Examples	:CALC:STAR? :CALC:STAR:STAT?

:STARt[:STATe] {ON | OFF}

Description	Sets the state of the :STARt function to either ON or OFF.
*RST value	OFF
Examples	:CALC:STAR ON :CALC:STAR:STAT OFF

:TIME[:ELAPsed]?

Description	Queries the elapsed time since the instrument was turned on or was reset.
Query Response	A time in HH:MM:SS format.
Examples	:CALC:TIME? :CALC:TIME:ELAP?

DISPlay Subsystem

The DISPlay subsystem is used to manipulate the instrument's front panel through the serial or GPIB SCPI interface. These commands do not affect the readings from the SCPI interface except for the :RESolution function.

DISPlay Subsystem Functions

:DIALog?

Description	Queries what display dialog is currently on the instrument's front panel display. The return value for this function is invalid if the instrument is on a setup dialog.
Query Response	{MAIN WAVELENGTH POWER}
Examples	:DISP:DIAL?

:DIALog {MAIN | WAVelength | POWer}

Description	Sets the dialog that is on the instrument's front panel display.
*RST value	MAIN
Examples	:DISP:DIAL MAIN :DISP:DIAL POW

:RESolution?

Description	Queries the current resolution of the instrument.
Query Response	{0.0001 0.001 0.01 0.1 1.0 10.0 100.0}
Examples	:DISP:RES?

:RESolution {0.0001 | 0.001 | 0.01 | 0.1 | 1.0 | 10.0 | 100.0}

Description	Sets the resolution for wavelength, frequency and wavenumber readings. It is the same as using the Resolution function through the display. The 0.0001 setting is valid only for the WA-1650.
*RST value	0.001
Examples	:DISP:RES 0.0001

:UNITs:POWer?

Description	Queries the units being used for power values on the front panel display.
Query Response	{DBM MICROWATTS MILLIWATTS}
Examples	:DISP:UNIT:POW?

:UNITs:POWer {DBM | MICRowatts | MILLiwatts}

Description	Sets the units being used for power values on the front panel display. It is the same as changing the power units through the display. If the units are set to MICRowatts or MILLiwatts, the display may switch to MILLiwatts or MICRowatts due to the display's Power Autorange feature.
*RST value	DBM
Examples	:DISP:UNIT:POW MICR :DISP:UNIT:POW DBM

:UNITs:WAVelength?

Description	Queries the units being used for wavelength values on the front panel display.
Query Response	{NM GHZ}
Examples	:DISP:UNIT:WAV?

:UNITs:WAVelength {NM | GHZ}

Description	Sets the units being used for wavelength values on the front panel display. It is the same as changing the wavelength units through the display.
*RST value	NM
Examples	:DISP:UNIT: NM

SENSe Subsystem

The SENSe subsystem allows changes in how the instrument makes measurements and provides information on the reference laser.

SENSe Subsystem Functions

:AVERage?

Description	Queries the number of readings being averaged for wavelength and power values.
Query Response	{OFF 2 4 8 16 32 64 128}
Examples	:SENS:AVER?

:AVERage {OFF | 2 | 4 | 8 | 16 | 32 | 64 | 128}

Description	Sets the number of readings being averaged for wavelength and power values. It is the same as using the Average function through the display.
*RST value	OFF
Examples	:SENS:AVER OFF :SENS:AVER 8

:MEDium?

Description	Queries the medium used for wavelength calculations.
Query Response	{AIR VACUUM}
Examples	:SENS:MED?

:MEDium {AIR | VACuum}

Description	Sets the medium used for wavelength calculations. It is the same as using the Medium function through the display.
*RST value	VAC
Examples	:SENS:MED AIR :SENS:MED VAC

:POWERoffset?

Description	Queries the power offset being added to power values. It is the same as using the Poffs function through the display. The power offsets are in units of dBm.
Query Response	{OFF 1 2 3 ... 19 20}
Examples	:SENS:POW?

:POWERoffset {OFF | 1 | 2 | 3 | ... | 19 | 20}

Description	Sets the power offset to be added to power values. The power offsets are in units of dBm.
*RST value	OFF
Examples	:SENS:POW OFF :SENS:POW 3

:REFerence[:PARameters]?

Description	Queries the reference laser status.
Query Response	For the WA-1650, power in μW , % of peak power and minutes to warm up are returned, separated by commas (ex. 267.0 UW, 76 %, 7). For the WA-1150, just the power in μW is returned (ex. 267.0 μW).
Examples	:SENS:REF? :SENS:REF:PAR?

:SENSe:RANGe {0 – 3}

Description	Sets the spectral range (as shown by Freq. Range on the Configuration screen) to be measured by the instrument.
Query Response	0 – 700 to 1266 1 – 1266 to 1650 2 – 1266 to 1475 3 – 1450 to 1650
Examples	For example to change to 700 to 1266: :SENS:RANG 0

:SENSe:RANGe?

Description	Queries the spectral range being measured by the instrument.
Query Response	:SENS:RANG?
Examples	The response is: 0

STATus Subsystem

The STATus subsystem is used to retrieve status information from the instrument and to mask or screen what status is able to be retrieved.

Status registers give information about the instrument and the latest measurement. Status enable registers allow some status information to be ignored. Status information disabled though the status enable registers will not show up in the status registers.

STATus Subsystem Functions

:QUESTionable:CONDition?

Description	Queries the SCPI Questionable register which contains bits that indicate that one or more measurement types are of questionable accuracy. The bits in the register are described in the table below.
Query Response	An integer which is the sum of the bit values for all bits in the register that are set.
Examples	:STAT:QUES:COND?

Questionable Register

Bit	Bit Value	Description
0	1	Wavelength has been read already for the current scan.
1	2	(not used)
2	4	(not used)
3	8	Power value is outside the valid range of the instrument.
4	16	Temperature value is outside the valid range of the instrument.
5	32	Wavelength value is outside the valid range of the instrument.
6	64	(not used)
7	128	(not used)
8	256	(not used)
9	512	Pressure value is outside the valid range of the instrument.
10	1024	At least one bit is set in the Questionable Hardware Condition register.

:QUESTionable:ENABle?

Description	Queries the SCPI Questionable Enable register.
Query Response	An integer which is the sum of the bit values for all bits in the register that are set.
Examples	:STAT:QUES:ENAB?

:QUESTionable:ENABle <integer>

Description	Used to set and clear bits in the SCPI Questionable Enable register. This register contains bits that are used to mask one or more conditions indicated in the Questionable register. Setting a bit causes that condition to be masked so that, even if the condition is true, its associated bit will not get set in the Questionable register. The Questionable Enable register has the same format as the Questionable register (see table above).
Examples	:STAT:QUES:ENAB 1 :STAT:QUES:ENAB 1024

:QUESTionable:HARDware:CONDition?

Description	Queries the SCPI Questionable Hardware Condition register which contains bits that indicate that one or more hardware problems exist. These problems may contribute to invalid or erred measurements. The bits in the register are described in the table below.
Query Response	An integer which is the sum of the bit values for all bits in the register that are set.
Examples	:STAT:QUES:HARD:COND?

Questionable Hardware Condition Register

Bit	Bit Value	Description
0	1	Reference laser has not stabilized (WA-1650 only).
1	2	Reference laser is over temperature (WA-1650 only).
2	4	No reference laser fringes detected during scan.
3	8	Lost reference laser fringes during scan.
4	16	Analog to digital converter error.
5	32	Failed to read the EEPROM.
6	64	Failed to read or write to the SRAM.
7	128	Scan assembly has stopped moving.
8	256	Input laser fringe strength is too low.
9	512	Not used.
10	1024	Not used.

11	2048	Not used.
12	4096	Input laser fringe strength is too high.
13	8192	Reference laser % of peak power is out of range (WA-1650 only).

SYSTem Subsystem

The SYSTem subsystem supplies information and status about the SCPI command parser and allows control over the instrument's front panel.

SYSTem Subsystem Functions

:ERRor?

Description	Reads error strings from the SCPI Error Queue. If the Error Queue has any entries, the Error Queue bit is set in the Status Byte. The instrument has a 30 entry, first-in, first-out queue. Repeatedly sending the query :SYST:ERR? returns the error numbers and descriptions in the order in which they occurred until the queue is empty. Any further queries return 0, "No error" until another error occurs. A table of possible errors is shown below.
Query Response	<integer>, <string> (ex. -104, "Data type error")
Examples	:SYST:ERR?

SCPI Errors

Error Number	Description
0	No error
-101	Invalid character
-102	Syntax error
-103	Invalid separator
-104	Data type error
-220	Parameter error
-221	Settings conflict
-222	Data out of range
-230	Data corrupt or stale

:HELP:HEADers?

Description	Reads a list of all commands and queries supported by the instrument. Each line of the response is terminated by a linefeed. The first line indicates the number of bytes of help data that follow. The remaining lines are strings of help data. All lines of data must be read before continuing normal operations.
Query Response	#<integer> <string> <string> <string> ... <string>
Examples	:SYST:HELP:HEAD?

:REMote?

Description	Queries the state of the remote lockout feature.
Query Response	{ON OFF}
Examples	:SYST:REM?

:REMote {ON | OFF}

Description	Sets the state of the remote lockout feature. When the state is ON, front panel input is locked out and the instrument can only be operated remotely using SCPI commands.
*RST value	OFF
Examples	:SYST:REM ON :SYST:REM OFF

:VERSion?

Description	Returns the version of the SCPI specification that the instrument's SCPI interface is based on. The first integer is the year and the second integer is the approved revision number for that year.
Query Response	<integer>.<integer>
Examples	:SYST:VERS?

TRIGger Subsystem

The instrument is unlike most SCPI instruments in that it is continuously taking readings and when a reading starts is under the control of the scan engine and not the user. As a result, the user should not attempt to control the instrument through the Trigger subsystem. The commands below are listed only for the sake of completeness.

TRIGger Subsystem Functions

:ABORt

Description	Halts acquisition of the current reading and returns the instrument to an idle state.
Examples	:ABOR

:INITiate[:IMMediate]

Description	Starts the acquisition of a new reading.
Examples	:INIT :INIT:IMM

UNIT Subsystem

For the instrument, there is a single query and command in the UNIT subsystem. They query and change the units that the SCPI interface uses for reporting power.

UNIT Subsystem Functions

:UNIT:POWer?

Description	Queries the state of the power units that will be used when the SCPI interface returns power values.
Query Response	{DBM W}
Examples	:UNIT:POW?

:UNIT:POWer {DBM | W}

Description	Sets the state of the power units that will be used when the SCPI interface returns power values. This setting does not affect the front panel display.
*RST value	DBM
Examples	:UNIT:POW DBM :UNIT:POW W

4. Theory of Operation & Calibration

This section reviews the theory behind the operation of the WA-1150 and WA-1650. It also discusses the factors that influence the accuracy of the measurement.

Operating Principles

The WA-1150/1650 instruments use a Michelson interferometer to generate interference fringes from the input radiation. The input laser beam enters the instrument through a fiber-optic connector on the front panel. After collimation, the beam is directed into the Michelson interferometer. At the beamsplitter, the input beam is divided into two beams that follow separate optical paths. One beam reflects off the moving retroreflector assembly and returns to the beamsplitter. The other beam reflects off of a fixed retroreflector and returns to the beamsplitter where it interferes with the first beam. The relative lengths of the two paths govern whether constructive or destructive interference occurs at the beamsplitter. As the retroreflector moves back and forth, the detected intensity for each wavelength of the input beam varies sinusoidally.

In order to extract all the spectral components in the input beam from the Michelson interferometer fringe pattern, it is necessary to sample the detected intensity at precisely calibrated intervals in the scan of the interferometer. This is accomplished by introducing into the interferometer a second “reference” laser with an accurately known wavelength. This laser measures the displacement of the moving arm of the interferometer and provides a signal for accurately sampling the input laser fringe pattern.

After a large number of intensity values have been recorded from one scan of the interferometer, a Fast Fourier Transform is performed on the data to produce the spectrum of the input laser source. The spectral peak with the highest intensity is used to calculate the input laser wavelength.

A small portion of the input beam entering the instrument is split off into a power meter. This measurement of the total input power is used to calculate the absolute power of the input laser source.

Wavelength Accuracy

The wavelength accuracy of the peaks in the instrument spectrum is dependent on the knowledge of the reference laser wavelength and appropriate corrections for the dispersion in the refractive index of air. The WA-1150/1650 uses a HeNe reference laser with refractive index correction based on temperature and pressure measurements inside the interferometer. The absolute accuracy of the reference laser wavelength used in the

WA-1150 is better than 0.5 parts per million. The absolute accuracy of the reference laser wavelength used in the WA-1650 is better than 0.1 parts per million.

Wavelength accuracy also depends on the alignment of the reference laser beam and the input laser beam in the Michelson interferometer. Fiber-optic input coupling and stable optomechanical design ensure that the interferometer alignment does not change significantly with time and environmental conditions.

At the time of manufacturing, the wavelength accuracy of each WA-1150/1650 is verified with an accurately known laser source, such as a Distributed Feedback (DFB) diode laser locked to the R(3) band of acetylene ($^{12}\text{C}_2\text{H}_2$). The center of this absorption line has been characterized to $196,832.341 \text{ GHz} \pm 150 \text{ KHz}$ by K. Nakagawa et al. in "Accurate optical frequency atlas of the 1.5 μm bands of acetylene," JOSA, B, 13, 2708 (1996) using an absorption line of rubidium as the reference standard.

Power Accuracy

The WA-1150/1650 internal power meter is designed with excellent linearity over the full specified power range. Correction for the responsiveness of the power detector also ensures that good power measurement flatness is achieved over the operating wavelength range.

With the complete spectrum normalized to the total power measurement, the power in each spectral peak is computed from the integrated intensity under that peak relative to the average local baseline.

The internal power meter in every WA-1150/1650 is calibrated at the time of manufacturing using a high-precision power meter that is regularly certified accurate traceable to NIST.

Calibration

The recommended calibration interval is one year.

Appendix A. Specifications & Labeling

This appendix provides specifications, dimensional drawings and labeling information.

Table A-1. Specifications

	WA-1150	WA-1650
Wavelength		
Range	700-1650 nm (181 – 428 THz)	
Absolute accuracy**	± 1.5 pm @ 1500 nm (± 1.0 ppm)	± 0.3 pm @ 1500 nm (± 0.2 ppm)
Display resolution	0.001 nm	0.0001 nm
Units	nm (vacuum), GHz	
Power		
Absolute accuracy	± 0.5dB (at ± 30 nm from 1310 and 1550 nm)	
Resolution	± 0.05dB	
Linearity	± 0.3 dB	
Display resolution	0.01 dB	
Units	dBm, mW, μW	
Optical Input Signal		
Sensitivity (1200 to 1600 nm)*	- 40 dBm (0.1 μW)	
Sensitivity (700 to 1650 nm)	- 30 dBm (1 μW)	
Maximum input level	+ 10 dBm (10 mW)	
Maximum safe level	+ 18 dBm (63 mW)	
Measurement Update		
Time (rate)	1 sec (1 measurement/sec)**	1 sec (1 measurement/sec)
Inputs/Outputs		
Optical input	9/125 μm fiber FC/UPC or FC/APC SC/UPC or SC/APC ST/UPC	
Instrument interface	GPIB (IEEE 488.2), RS-232, LabVIEW, LabWindows	
Environmental		
Nominal warm-up time	NA	7 minutes
Temperature	+ 15 to + 30 °C (- 10 °C to + 70 °C storage)	
Pressure	500 to 900 mm Hg	
Relative humidity	≤90% R.H. at 40 °C (no condensation)	


Dimensions and Weight		
Dimensions (H x W x D)	3.5" x 17.0" x 16.5" (89 mm x 431.8 mm x 419.1 mm)	
Weight	17 lbs. (7.65 kg)	18 lbs. (8.18 kg)
Power Requirements		
Voltage and frequency	90 to 260 VAC, 50/60 Hz	

*Measurement repeatability is reduced when input < - 35 dBm

** Measurement rate is 1 second or two seconds, depending on the wavelength source selected.

Dimensional Drawing

Figure A-1. Dimensions in inches (mm)

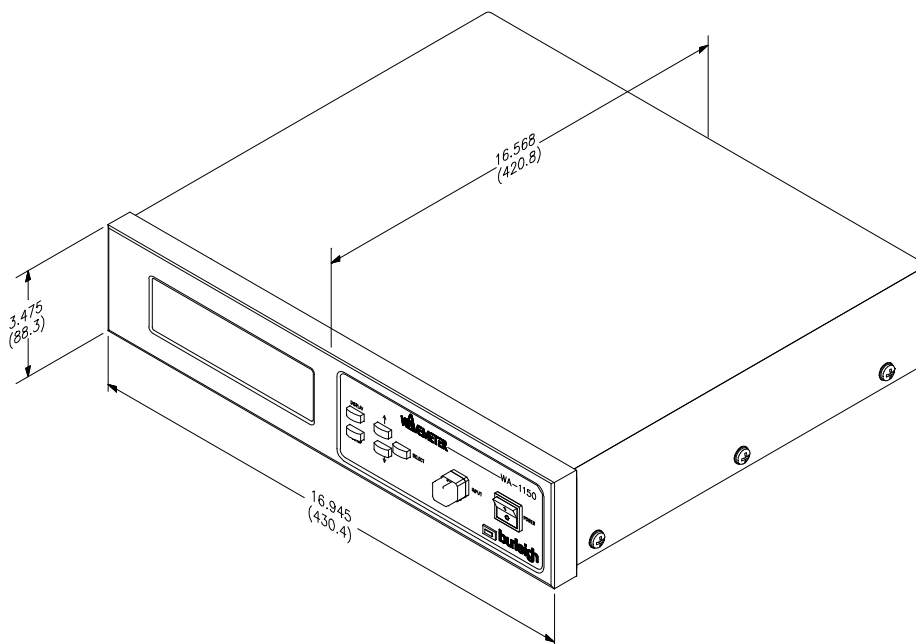

Rack Mounting Option

The WA-1150/1650 can be mounted in a standard 19" electronics rack by attaching the rack mounting brackets.

NOTE When the WA-1150/1650 is mounted in an enclosed rack, be careful not to block the fan on the rear panel and to provide adequate ventilation inside the rack to prevent overheating.


For proper fit, you may want to remove the feet under the chassis.

CAUTION If you remove the feet, **DO NOT** reinsert the screws or damage to the internal components of the instrument can occur.

To attach the rack mounting brackets

1. Remove the set screws from the bezel.
2. Attach the bracket to the bezel using the two 6-32 x 1/4" SHC screws.

Figure A-2. Attaching Rack Mounting Brackets

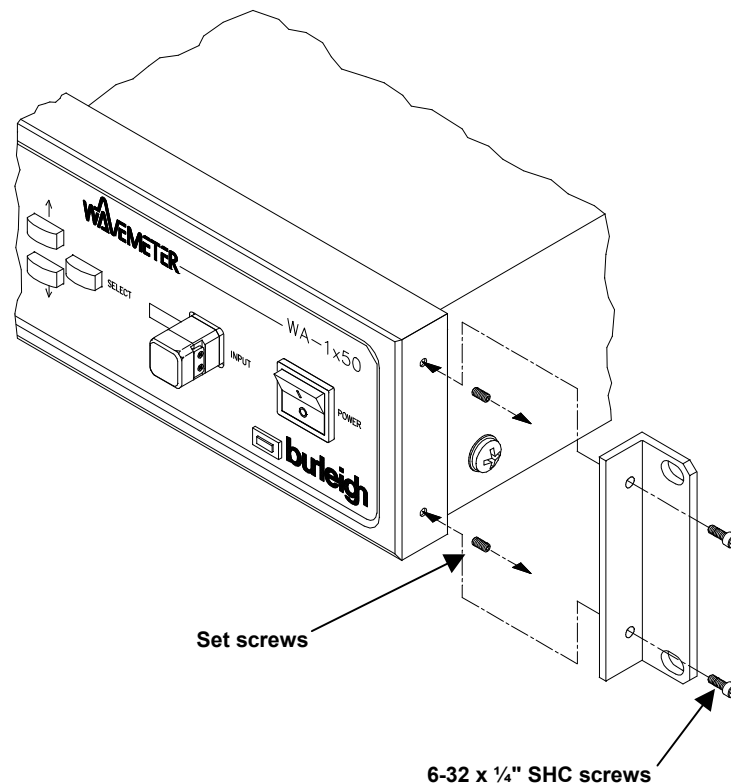

Appendix B. Warranty & Service

Warranty

The WA-1150 and WA-1650 are warranted against defects in material and workmanship for a period of one year after date of delivery. Optical components are warranted for 90 days. During the warranty period, EXFO will repair or, at its option, replace parts that prove to be defective when the instrument is returned prepaid to EXFO Burleigh Products Group Inc. **Before returning an instrument always call EXFO Burleigh Products Group for return authorization.** The warranty will not apply if the instrument has been damaged by accident, misuse or as a result of modification by persons other than EXFO personnel.

It is important to call EXFO Burleigh Products Group or your local sales representative in advance of returning a unit, for a Return Authorization Number (RA#). This will ensure the prompt handling of the repair, as well as provide important tracking information.

The liability of EXFO Burleigh Products Group Inc., (except as to title) arising out of supplying of said product, or its use, whether under the foregoing warranty, a claim of negligence, or otherwise, shall not in any case exceed the cost of correcting defects in the products as herein provided. Upon expiration of the warranty period specified herein, all liability shall terminate. The foregoing shall constitute the sole remedy of the buyer. In no event shall the seller be liable for consequential or special damages.

Service

There are no user-serviceable parts inside the WA-1150 and WA-1650. Adjusting parts inside the instrument can affect the accuracy of the instrument. If you adjust parts, you will need to verify the accuracy of the measurements and the factory calibration will be void.

Appendix C. Error & Status Messages

The instrument continually checks the quality of the signal it is analyzing and reports messages for any unusual conditions that might affect the precision of the measurement. There are two types of messages. In most cases, **error messages** will prevent data from being reported. These are displayed in the display screens. The error messages also will be reported as **status messages** that will be reported in the status screen or can be queried through remote communications. Some status messages may not prevent data from being reported, and indicate that there may be unusual operation of the laser under test and are to simply caution the user that a problem may exist.

Error Messages

In the following table, the error messages are described with a cross-reference to the status screen reference code. The error messages are shown in order of how they would appear if there were multiple errors.

Table C-1. Error Messages

Display Message	Cause/Solution	Status Screen Reference
"Loading Default Settings"	Indicates the original calibration and set-up data have been corrupted and default values will be used.	none
"Reference Laser: Over Temperature"	WA-1650 only. The reference laser stabilization circuit is indicating an over-temperature condition. Turn the instrument off, wait 15 minutes and power up again. If the problem persists, contact EXFO Service.	00000002
"Reference Laser: Calibration Error"	WA-1650 only. Reference laser power is outside the 60 to 85% range necessary for proper operation. Recalibration is necessary. Contact EXFO Service.	00040000
"Reference Laser: Not Stabilized"	WA-1650 only. This message is normal on power up for up to 7 minutes. The display shows warm-up time. Turning power off and on again will restart the warm-up timer. If this condition occurs after initial warm-up then contact EXFO Service.	00000001
"Scan Engine: No Trigger"	Interferometer scan motion error. Either the scan assembly is not moving or the scan timing detector is malfunctioning. Contact EXFO Service.	00000080

"Temperature/Pressure Sensor: Out of Range"	The pressure or temperature reading is out of range; the normal pressure range is 500 to 900 mm Hg and the normal temperature range is 1 to 50 °C. A temperature or pressure reading of 0 usually indicates the sensor is not connected or has a broken wire. Contact EXFO Service.	00001000 and 00002000
"Reference Laser: No Fringes Detected"	Detector failure or insufficient signal amplitude from the reference laser. This may be due to a decrease in reference laser power or a major misalignment of the internal optics. Contact EXFO Service.	00000004
"Input Laser: Intensity Too Low"	The input laser signal observed at the Monitor output must exceed 1.5 volts p-p amplitude. Set gain to auto. Check input laser power. Increase the intensity of the input laser beam entering the instrument.	00000100
"Input Laser: Wavelength Out Of Range"	Check that the laser is operating within the specified wavelength range: 700-1650 nm.	00008000

Status Messages

The following table describes the complete set of status messages that can appear in the status screen. The messages are listed in numerical order.


Table C-2. Status Messages

Status Message	Description	Solution
	Load default settings	Indicates the original calibration and set-up data have been corrupted and default values will be used.
00000001	WA-1650 only. Reference laser is not stabilized.	This message is normal on power up of the WA-1650. The display shows warm-up time. Turning power off and on again will restart the warm-up timer. If this condition occurs after initial warm-up then contact EXFO Service.
00000002	WA-1650 only. Reference laser is over temperature.	The laser stabilization circuit is indicating an over-temperature condition. Turn the instrument off, wait 15 minutes and power up again. If the problem persists, contact EXFO Service.
00000004	Detector failure or insufficient signal amplitude from the reference laser.	This may be due to a decrease in reference laser power or a major misalignment of the internal optics. Contact EXFO Service.

00000008	Intermittent signal from the reference laser during the measurement window.	Reference laser signal at the Monitor output should exceed 2.0 volts p-p throughout the measurement window. This may be due to partial misalignment of the instrument internal optics.
00000020	EEPROM read failure. Problem occurs on power up or when restoring.	Turn the instrument off, wait a few moments and turn the instrument back on. If the problem persists contact EXFO Service.
00000040	Static RAM read/write failure. This error may occur on power up.	Turn the instrument off, wait a few moments and turn the instrument back on. If the problem persists contact EXFO Service.
00000080	Interferometer scan motion error.	Either the scan assembly is not moving or the scan timing detector is malfunctioning. Contact EXFO Service.
00000100	Input signal (fringe amplitude) is too low.	The input laser signal observed at the Monitor output must exceed 1.5 volts p-p amplitude. Set gain to auto. Check input laser power. Increase the intensity of the input laser beam entering the instrument.
00001000	Pressure reading is out of range; range is 500 to 900 mm Hg.	If the problem persists contact EXFO Service.
00002000	Temperature reading is out of range; range is 1 to 50°C.	A temperature reading of 0°C usually indicates the temperature sensor is not connected or has a broken wire. If the problem persists contact EXFO Service.
00004000	Input laser power error, power is out of range	Check that the laser is operating within the specified power range. If no wavelength is indicated, then 1550 nm is assumed in the power calculation.
00008000	The wavelength (or frequency) measurement is out of the range for the model setting.	Check that the laser is operating within the specified wavelength range: 700-1650 nm.
00010000	Power null failure.	The background power reading is above the threshold for the power null function. Make sure an input laser is removed from the instrument and the fiber connector cap is on.
00040000	WA-1650 only. Reference laser peak power outside the 60 to 85% range necessary for proper operation.	Recalibration is necessary. Contact EXFO Service.
00080000	Input power too high.	Check if input laser is above the specified maximum input power.
00100000 00200000 00400000 00800000	Internal communications error.	If persistent, contact EXFO Service


Appendix D. Rear Panel Controls

Rear Panel

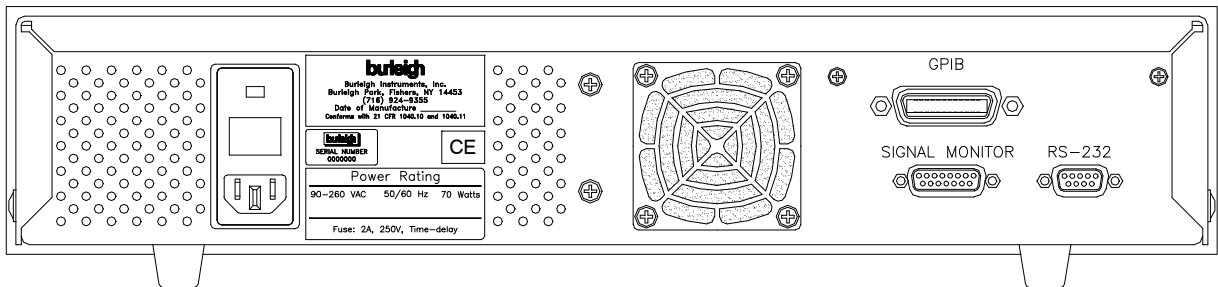

GPIB Interface

The instrument has a GPIB communications port on the back panel as shown above. The GPIB port uses the standard IEEE-488 connector, with the pinout described below.

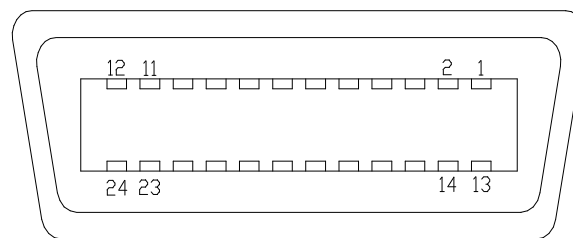

Standard IEEE-488 Connector Pinout

Pin Number	Signal Name
1	DIO1
2	DIO2
3	DIO3
4	DIO4
5	EOI
6	DAV
7	NRFD
8	NDAC
9	IFC
10	SRQ
11	ATN
12	SHIELD

Pin Number	Signal Name
13	DIO5
14	DIO6
15	DIO7
16	DIO8
17	REN
18	GND (TW W/ DAV)
19	GND (TW W/ NRFD)
20	GND (TW W/ NDAC)
21	GND (TW W/ FC)
22	GND (TW W/ SRQ)
23	GND (TW W/ ATN)
24	SIGNAL GROUND

GPIB System Controller Settings

This section describes how to set up your GPIB system controller for proper message termination and bus timing to communicate with the WA-1150 or WA-1650. Other settings may work as well, but these are the settings that we've found to work the best.

Set EOI at End of Write = Yes

This causes the system controller to assert the EOI signal during the last byte of a message written to the instrument.

Set EOI With EOS on Write = No

The system controller should not assert the EOI signal when it writes an EOS character. The system controller should instead assert the EOI signal when sending the last byte of the message (which will be an EOS character anyway).

EOS Byte = 10

The instrument uses a linefeed character (10, 0x0a, or \n) to identify the end of a message.

8-Bit EOS Compare = Yes

This causes the system controller to examine all eight bits of a received character to determine if it is an EOS character.

Terminate Read on EOS = Yes

The instrument terminates all of its messages with an EOS character. It never uses the EOS character within a message. Therefore, when the system controller receives an EOS character from the instrument, it can assume that it has received the last character of the message.


GPIB Bus Timing = 2000 ns or 2 μ s

This sets the minimum time that the system controller will assert the DAV signal after driving a byte onto the bus.

RS-232 Interface

The RS-232 port is a 9-pin, female, D-sub style connector, with the pinout described below. The connector housing provides connection to the earth ground inside the instrument.

The pin configuration complements that of the PC/AT. To connect the instrument to a PC/AT, use a serial extension cable with 1:1 pin correlation. To facilitate the connecting of the serial port, use the signal descriptions (H = Active).

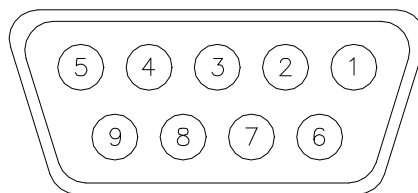

RS-232 Serial Port Pinout

Pin Number	Signal Name	Signal Source	Description
1	-	-	N/C
2	TxD	WA-1150/1650	Transmit Data. Data from the instrument is output on this signal pin.
3	RxD	User	Receive Data. Data from the user is received on this signal pin.
4	DSR	User	Data Set Ready. This input signal must be held active by the user for the instrument to consider the serial port connected to an external device.
5	GND	-	Signal Ground. Required for proper RS-232 operation.

6	DTR	WA-1150/1650	Data Terminal Ready. This output signal is active whenever the instrument is powered and is not in internal reset.
7	CTS	User	Clear To Send. An input signal indicates to the instrument when the user device is able to accept additional data.
8	RTS	WA-1150/1650	Request To Send. The instrument makes this signal active as long as its internal command buffer has room in it. When the internal command buffer is full, the instrument sets RTS inactive.
9	-	-	N/C

Signal Monitor Connector

The Signal Monitor connector on the back panel of the instrument provides a combination of analog and digital signals for observing the fringe signals and measurement timing signals using an oscilloscope. The signals have the characteristics described in Table D-1.

The Signal Monitor output is a 15-pin, female, D-sub style connector shown in Figure D-1 and with the pinout described in Table D-2.

Table D-1 Signal Monitor Characteristics

	Analog Signals	Digital (TTL) Signals
Output Voltage	± 7 V maximum	$V_{OL} = 0.4V$ max, $V_{OH} = 2.4V$ min
Output Current	100 mA maximum	$I_{OL} = 16$ mA max, $I_{OH} = -0.4$ mA
Output Timing	NA	$t_r \leq 7$ nsec, $t_f \leq 7$ nsec

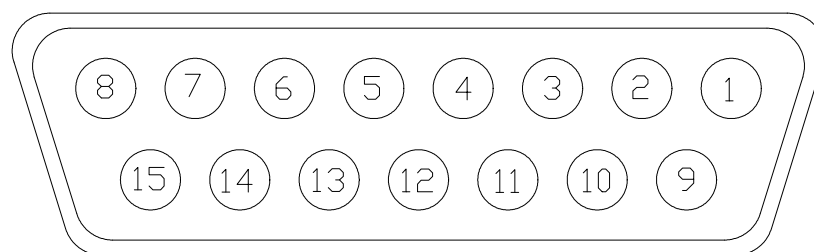



Figure D-1. Signal Monitor Output Connector

Table D-2 Signal Monitor Pinout

Pin Number	Signal Name	Signal Type	Description
1	INPUT	Analog	Input laser sinusoidal fringe signal.
2	REFERENCE	Analog	Reference laser sinusoidal fringe signal.
3	VREF	TTL	Valid reference laser fringe amplitude.
4			ZOP1 Raw
5	TRIGGER	TTL	Scanning Window Trigger is a digital pulse with a duration that defines the maximum measurement interval for the interferometer scan. It goes active (H = active) during the allowed measurement interval.
6	DGND	-	Digital Ground
7			1 TRIG
8	ZOP	TTL	Zero Optical Path (ZOP) is a digital pulse derived from the interferometer scanner that produces a low to high transition at the point in the scan where the difference between the two optical paths in the interferometer is zero.
9	AGND	-	Analog Ground
10	AGND	-	Analog Ground
11			N/C
12			N/C
13			N/C
14	DGND	-	Digital Ground
15	WINDOW	TTL	Scanning Window digital output is derived from the amplitude of the input laser fringe signal. When the p-p amplitude of this signal exceeds 1 volt, within the Trigger interval and before or spanning the ZOP transition, the Window is active (H = active). Depending on the character of the input laser fringes, there may be several Windows during a Trigger, but the first Window period to terminate after the ZOP transition is the only “Valid Window” used for the measurement.

Changing Fuses

The WA-1150/1650 can accept either single or dual line fuses as required by local regulations. The fuses are accessible at the rear panel of the instrument. The procedure for changing fuses is shown below.

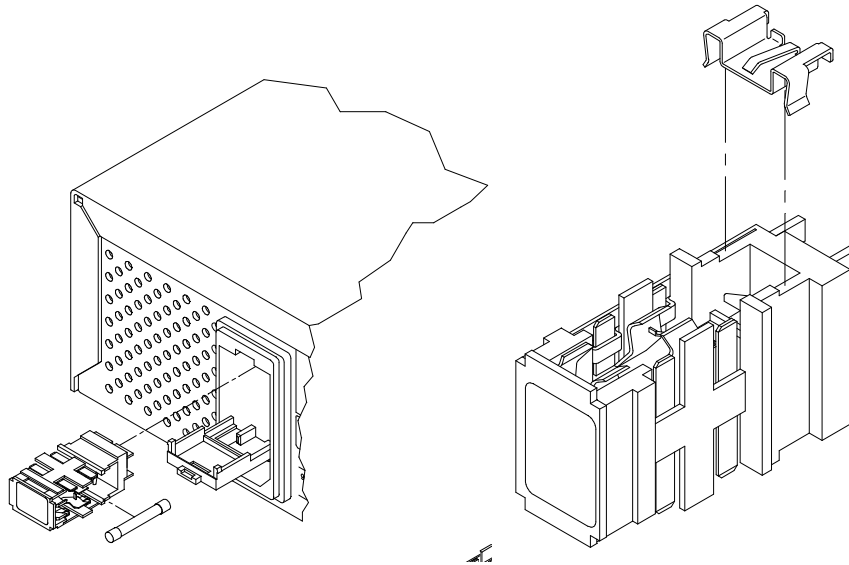

The fuse holder can be used for either single-line or dual-line fusing. The WA-1150/1650 comes from the factory with only one line fused. Removing the adapter clip allows dual fuses.

The fuse holder can hold 1.5 amp, slo-blo, $\frac{1}{4}$ " x $1\frac{1}{4}$ " or 5 x 20mm style fuses.

Declaration of Conformity

Manufacturer's Name: EXFO Burleigh Products Group Inc.

Manufacturer's Address: 7647 Main Street Fishers
Victor, NY 14564-8909
USA

declares this product:

Product Name: Wavemeter optical wavelength meter

Model Number(s): WA-1150
WA-1650

conforms to the following standards:

Safety: EN-61010-1: IEC 1010-1

EMC: EN-50081-1: EN-55011; Group 1, Class B : Emissions
EN-50082-1: EN 61000-4-2: ESD Immunity; 4kV CD, 8kV AD
EN 61000-4-3: RFI Immunity; 10V/M, 80-1000 MHz, Class I
EN 61000-4-4: Electrical Fast Transient Immunity; 2 kV
EN 61000-4-5: High Voltage Surge Immunity; 2 kV
EN 61000-4-6: Conducted RF Immunity

Supplementary Information: "The product complies with the requirements of the **Low Voltage Directive 73/23/EEC** and the **EMC Directive 89/336/EEC**."

European Sales Office: Scientifica Ltd.
9 Allied Business Center, Coldharbour Lane
Harpenden, Herts, AL5 4UT, UK

Date of Issue: March 2000



signed:

A handwritten signature in black ink, reading "David J. Farrell pres.", written over a horizontal line.

David J. Farrell, President

INDEX

A

Address of GPIB port..... 2-7, 2-8
Average 2-5, 2-6
Avg..... 2-5

B

Baud 2-7, 2-8
Brightness..... 2-7

C

Change display information 2-2
Changing fuses D-6
Cleaning
 Fiber end 1-3
Cleaning a fiber-optic connector 1-4
Cleaning a universal connector 1-4
Cleaning, fiber end 1-4
Commands
 CALCulate 3-10
 DISPLAY 3-13
 Measurement 3-8
 SENSe 3-15
 STATus 3-17
 SYSTem 3-19
 TRIGger 3-21
 UNIT 3-21
Communications setup screen 2-6
Components 1-3
Configuration setup screen 2-6
Connector
 Fiber-optic 1-4
 GPIB D-1
 Monitor D-4
 RS-232 D-3
 Universal 1-4

D

Display
 Instrument 2-1
 Screens 2-3
Display button 2-2

E

Error messages 2-5, C-1

F

Fiber end cleaning 1-3
Fiber-optic connector 1-4
Front panel 2-1
Fuse holder D-6

G

GPIB
 Connector D-1
 Enable/disable 2-7, 2-8

H

Handshaking 2-7, 2-8

I

IEEE-488 D-1
Information setup screen 2-6

L

Laser power current 2-5
Lockout *See Remote Lockout*

M

Main display screen 2-3
Medium 2-5
Monitor signal D-4

O

Operating principles 4-1

P

Poffs 2-5
Power 2-5
 Current 2-5
 Display screen 2-4
 Offset 2-5, 2-6
 Switch 2-2
Power accuracy 4-2

Power Autorange feature	2-5
Power null	2-6

R

Rack mounting option	A-3
Range	2-7
Remote lockout	2-3, 2-7
Reset	2-5
Resolution	2-6
Restore All	2-7
Restore parameters	2-3
Return authorization	B-1
RS-232	
Connector	D-3
Enable/disable	2-7, 2-8

S

Save All	2-7
Save parameters	2-3
SCPI	3-1
Screens	
Display	2-3
Setup	2-6
Select button	2-2
Service	B-1
Set up	1-3
Setup button	2-2

Setup screens	2-6
Signal	
GPIB	D-1
Monitor	D-4
RS-232	D-3
Specifications	A-1
Standard air	2-5
Status screen	2-6

U

Units	<i>See specific parameter's units</i>
Universal connector	1-4

V

Vacuum	2-5
--------------	-----

W

Warranty	B-1
Wavelength	
Current	2-5
Display screen	2-3
Wavelength accuracy	4-1

X

Xon/Xoff	2-7
----------------	-----

EXFO

EXFO Burleigh Products Group Inc.
7647 Main Street Fishers
Victor, NY 14564-8909
Tel: (585) 924-9355
Fax: (585) 924-9072

WA-1150/1650
09042-M-00